

Running Procedure for Rattler™ Connection

Procedure No: FT-RP-001

Rev: 00

Fermata™ Technologies



Approvals

Documented By	Rahul Deshpande (Fermata Technologies) & Daniel Ruiz (Oilfield Services & Technologies)	10/28/20
Reviewed By	Rahul Deshpande	10/28/20
Approved By	Ryan Broussard	10/28/20

Revision Control

Rev	Description of Changes	Date Issued
00	Issued for use	10/28/20

All material contained in this brochure is for general information only. This material should not, therefore, be used or relied upon for any specific application without independent competent professional examination and verification of its accuracy, suitability and applicability. Fermata Technologies, LLC does not assume any responsibility or liability for any loss, damage, injury resulting from the use of information and data

Running Procedure for Rattler™ Connection

Procedure No: FT-RP-001

Rev: 00

1. General Running Procedure

1.1 Refer to General Running Procedure No. FT-RP-000 latest revision.

2. Thread Compound Application

2.1 Fermata™ recommends the use of BOL 2000 or BOL 72733. The use of a fine brush is recommended to best control the application of thread compound. The brush should be free of any water. Water that is on the brush, connection, or in the running compound bucket must be completely removed before applying the compound. Apply a light coat of thread compound to the threads in the coupling only. When applying thread compound ensure the mill end pin is made up to the center of the coupling to prevent a low or high shoulder torque.



Image 1: Correct way to apply thread compound

Running Procedure for Rattler™ Connection

Procedure No: FT-RP-001

Rev: 00



Image 2: Do not apply thread compound to Rattler™ Pins

3. Compatibility

2.1 Rattler™ has limited compatibility with API BTC and differing weights within the same OD. Careful consideration of the performance properties of the weakest connection must be made by the operator.

Table 1 describes the make-up and performance criteria:

Pin End	Box End	Makeup Criteria	Performance
Rattler™	Rattler™	Rattler™	Rattler™
Rattler™	API BTC	API BTC	API BTC*
API BTC	Rattler™	Rattler™	API BTC*

(*) The string may retain Rattler™ performance if the API BTC connection is limited to accessories at the toe of the string and thread lock compound is used (ex: float equipment). Accessories threaded to API BTC used higher in the string (ex: air lock sub) will limit the string to API BTC performance.

Table 1

3. Make-up

3.1 Fermata™ recommends targeting the optimum make-up torque listed on the current connection data sheet. Any make-up torque between the minimum and maximum make-up torque is acceptable, but the optimum make-up torque is ideal for most conditions and common equipment. Add 10% to all specified make-up torque values when using thread locking compound. A torque shoulder must be visible for proper make-up.

3.2 Spin in the connection in high gear at a Revolutions per Minute (RPM) at or below that listed in Table 2.

3.3 Switch to low gear prior to shouldering and keep the RPM's at or below that listed in Table 2

3.4 The following (Table 2) is the recommended maximum make-up RPM.

Running Procedure for Rattler™ Connection

Procedure No: FT-RP-001

Rev: 00

Pipe Diameter	High Gear not to exceed	Low Gear not to exceed
4-1/2" to 5-1/2"	40 RPMs	15 RPMs
7" to 7-5/8"	20 RMPs	10 RPMs
9-5/8" and greater	15 RPMs	7 RPMs

Table 2

3.5 The shoulder torque is the point in which the pin noses make contact. This is indicated by a dramatic spike in the torque-turn graph and shall be clearly visible at a minimum of 5% of make-up torque and at a maximum of 90% of make-up torque. If the shoulder torque is outside of these specifications, break out and inspect the pin and coupling. A large torque increase prior to the shoulder point may indicate a problem in make-up such as cross-threading.

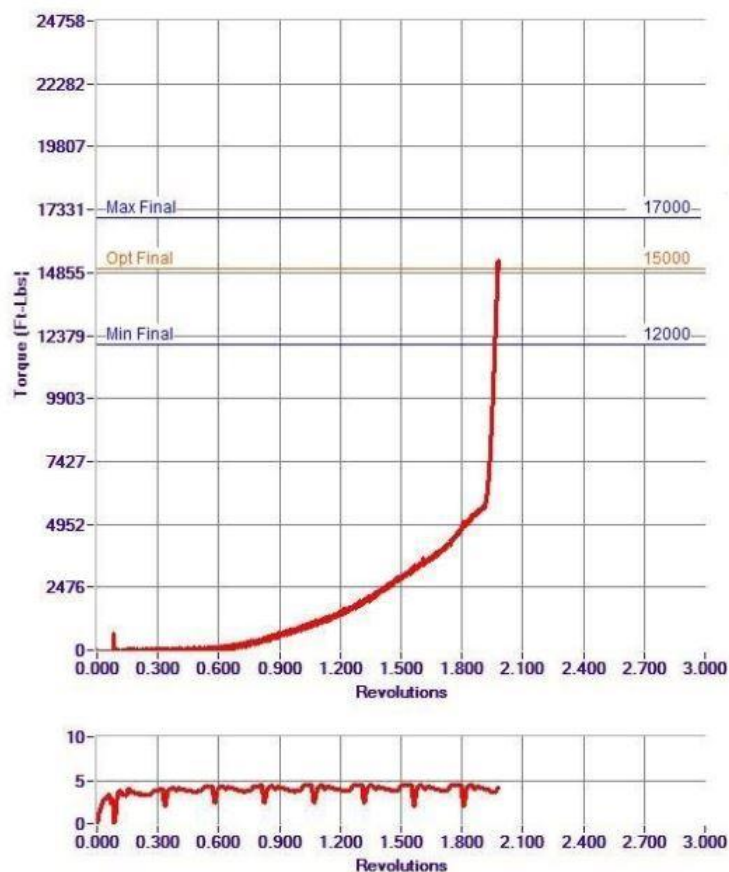


Figure 1: Correct make-up graph

4. Downhole Rotation

- 4.1 The maximum operating torque listed on the current connection data sheet is the maximum torque for downhole rotation. Speed should not exceed 40 RPM.
- 4.2 Take care to gradually increase or decrease rotation speed and torque to prevent potential dynamic loading scenarios.

Running Procedure for Rattler™ Connection

Procedure No: FT-RP-001

Rev: 00

5. Break out and Inspection

- 5.1 Verify back-up tongs are equipped with the appropriately sized dies prior to break-out.
- 5.2 Place the back-up tongs on the lower half of the coupling and not on the pipe body for threaded & coupled connections to ensure breaking out the field end pin.
- 5.3 Break-out the connection in low gear to ensure adequate torque capability.
- 5.4 Keep break-out speed low to prevent galling (preferably 5 RPM or less).
- 5.5 Break-out slowly until the pin “jumps”, indicating disengagement.
- 5.6 Use a stabbing guide prior to disengagement to prevent damage to the connection.
- 5.7 Alignment is equally important during break-out as during make-up. Verify alignment prior to break-out.
- 5.8 If re-running, fully break-out the connection, remove all thread compound and debris, inspect, and follow the make-up procedure. If laying down, apply storage compound and thread protectors free of grime and debris.